

Manhole Inspection Summary

Manhole # S55A__004MH

Printed On: 1/22/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **55A** Node: **004** Status: **Found**

Insp Date: **6/24/08 8:25 AM**

Incomplete Comments

Crew: **dd**
Inspector: **jjoirer**
Firm: **ATS**

Location Address: **3600 e fayette st**

Cross Street: **n conkling st**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **Bench is covered under surcharge.**

Cover Shape: **Circular** Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **3** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **4** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Unknown** ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☒ **Debris**

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☒ **Debris**

Steps Count: **4** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S55A__004MH


Printed On: 1/22/2009

Page 2 of 4

Location View



Top View

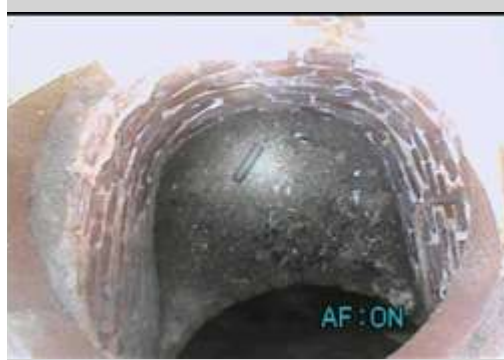

First top view

Miscellaneous



Inside top view

Defect 5



channel debris

Defect 4



bench and channel deteriorated

Defect 3




steps on other side

Defect 2



Cracked Chimney

Defect 1

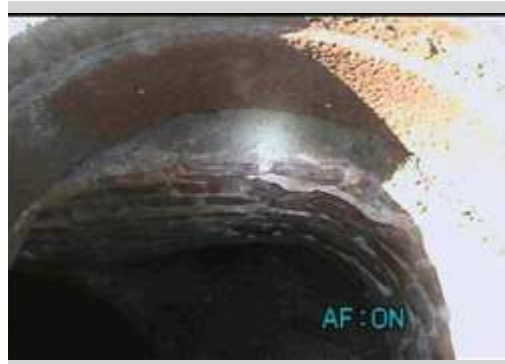

offset

Manhole Inspection Summary

Manhole # S55A__004MH

Printed On: 1/22/2009

Page 4 of 4

21 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 9.90 (ft.) Flow Characteristics: Slow

Deposits: ☐ None ☐ Mud ☒ Sludge ☒ Debris ☐ Grease

Silt Depth: 6 (in.) Deposits Extent: Heavy

Infiltration: None Pipe Seal Cond: Unknown

Drop: None

Connects To: Manhole

☐ Possible Illicit Connection

21 in. Circular Gravity Sewer
Pipe In @ 5 O'Clock

5 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 9.87 (ft.) Flow Characteristics: Slow

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: None Pipe Seal Cond: Unknown

Drop: None

Connects To: Manhole

☐ Possible Illicit Connection